SONY

Technical Bulletin

Date	Ref. No.	Model	PM
16.10.98	IP00798	CMD-X2000	
Subject			IRIS
No Battery Charging			1121

SYMPTOM

It is impossible to charge the battery.

CAUSE

Fuse F1 is open.

SOLUTION

- Disassemble the set up to the MMI Board.
- Check whether the fuse F1 is faulty.
- If F1 is open, replace it with the new part 1-533-867-21.
- Reassemble the set.
- Perform a full GSM specifications check.

