SONY

Service Bulletin

Date	Ref. No.	Model	TD
07.02.97	IP00297	CM-DX1000	
Subject			IRIS
Disassembly of Set			

SYMPTOM

Disassembling the CM-DX1000 may lead to damage of the Upper or Lower Case Shell due to incorrect handling.

CAUSE

The factory assembly of the CM-DX1000 cosmetics is rather tight, and on the upper side, both major parts are held together by claws.

SOLUTION

Apply the following procedure:

- · Remove the Antenna.
- · Remove the Battery Cover and the Battery.
- · Remove the SIM Card Holder.
- Remove four screws in the Battery Compartment.
- Hold the set in your hand with the display side in the palm of your hand.
- Take the Lower Case Shell at its bottom part (i.e. bottom of the Battery Compartment) and lift this part to an angle of approximately 15°.
- Now rotate the Lower Case Shell clockwise. You will meet some resistance. A loud click will be audible (releasing of the claws) and the Lower Case Shell will be correctly loosened.



