# SONY

# Service Bulletin

Date 31.10.95	Ref. No. <b>IP01695</b>	Model CM-DX1000	TD
Subject Poor Reception / Loss of Network Connection		IRIS 1223	

#### **SYMPTOM**


- Loss of network connection.
- No initial connection to network.
- Dropouts during connection.
- Short battery lifetime (due to constant network search).
- Low RF readout in monitor mode.

### **POSSIBLE CAUSE**

Poor or no connection between antenna and RF unit.

#### **SOLUTION**

Check the position of the contact plate on the RF unit. The plate should be correctly soldered and should be pointing upwards.

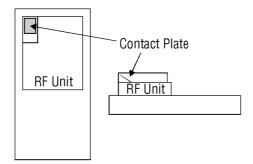

## **NOTE**

The above mentioned symptoms may all be provoked by other failures, too, which are not necessarily due to the set itself. Further checking and eventual repair may still be required.