SONY

Service Bulletin

Date 06.02.98	Ref. No.	Model CMD-X2000	TD
Subject			IRIS
Echo Problem			2551

SYMPTOM

During a telephone call originating from the CMD-X2000, the called party can hear the calling party echoing.

SOLUTION

Replace the "Cushion, Microphone" with the new part 3-020-342-01.

IMPORTANT REMARKS

- The original "Cushion, Microphone" is placed on the MMI Board, over the microphone.
- The replacement part, however, should be placed directly on top of the microphone on the front cosmetic, NOT on the MMI Board.
- After mounting the "Cushion, Microphone" on top of the microphone, peel off the protection plastic on top in order to allow the "Cushion, Microphone" to stick to the MMI Board when the set is reassembled.
- When ordering the part, two pieces will be delivered.

