

Service Service Service

Product Service Group CE Audio

Service Information

Already published Service Informations:

MCU & VCD BOARD

CHANGES DURING PRODUCTION

*From production week 0330 onwards the MCU & VCD board has been modified in order to eliminate the pink noise during CD playing.

Add IC1 5322 209 11548 MC74HC14AD

For servicing the new MCU & CD board, please refer to the attached pages.

OTHER CHANGE AND CORRECTION

***Correction of electrical parts list for Main Board:**


Add L106 9965 000 19723 Bead Ferrite

***Correction of electrical parts list for MCU & VCD Board:**


Add L106 9965 000 19729 Bead Ferrite

Change J101 9965 000 20837 FM Antenna Socket


CIRCUIT DIAGRAM - MCU & VCD BOARD
Main Part

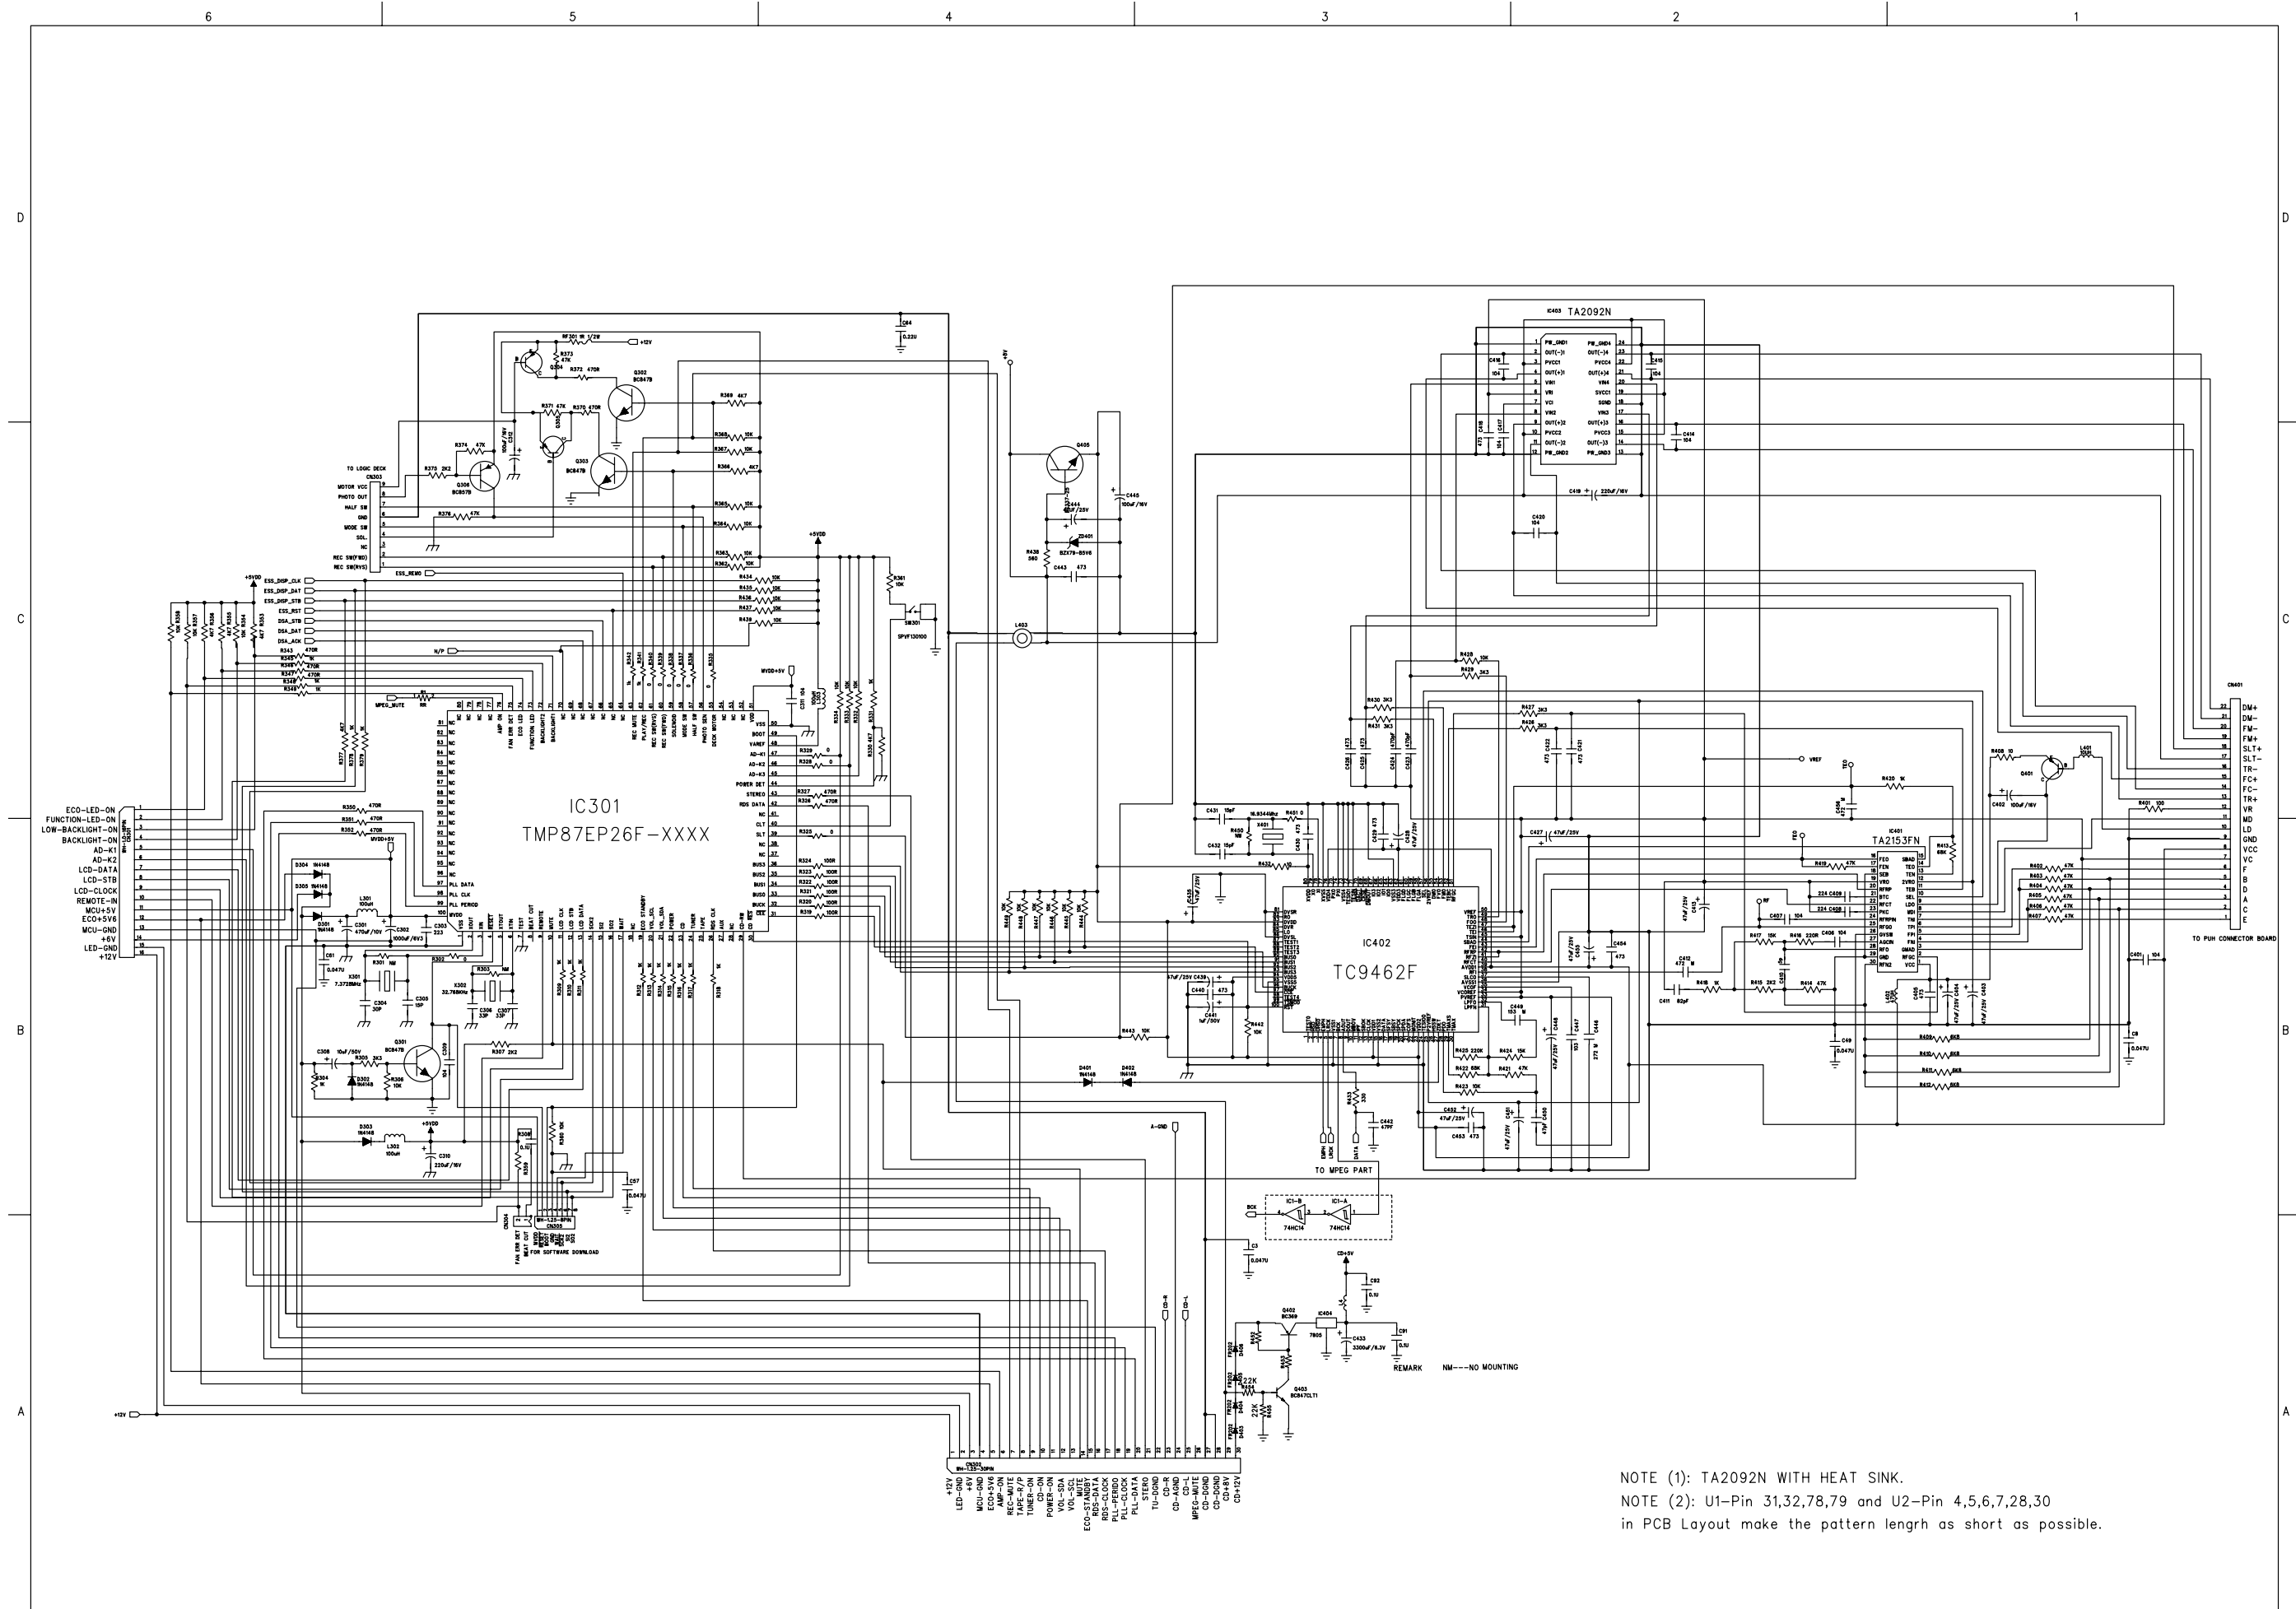

CIRCUIT DIAGRAM - MCU & VCD BOARD

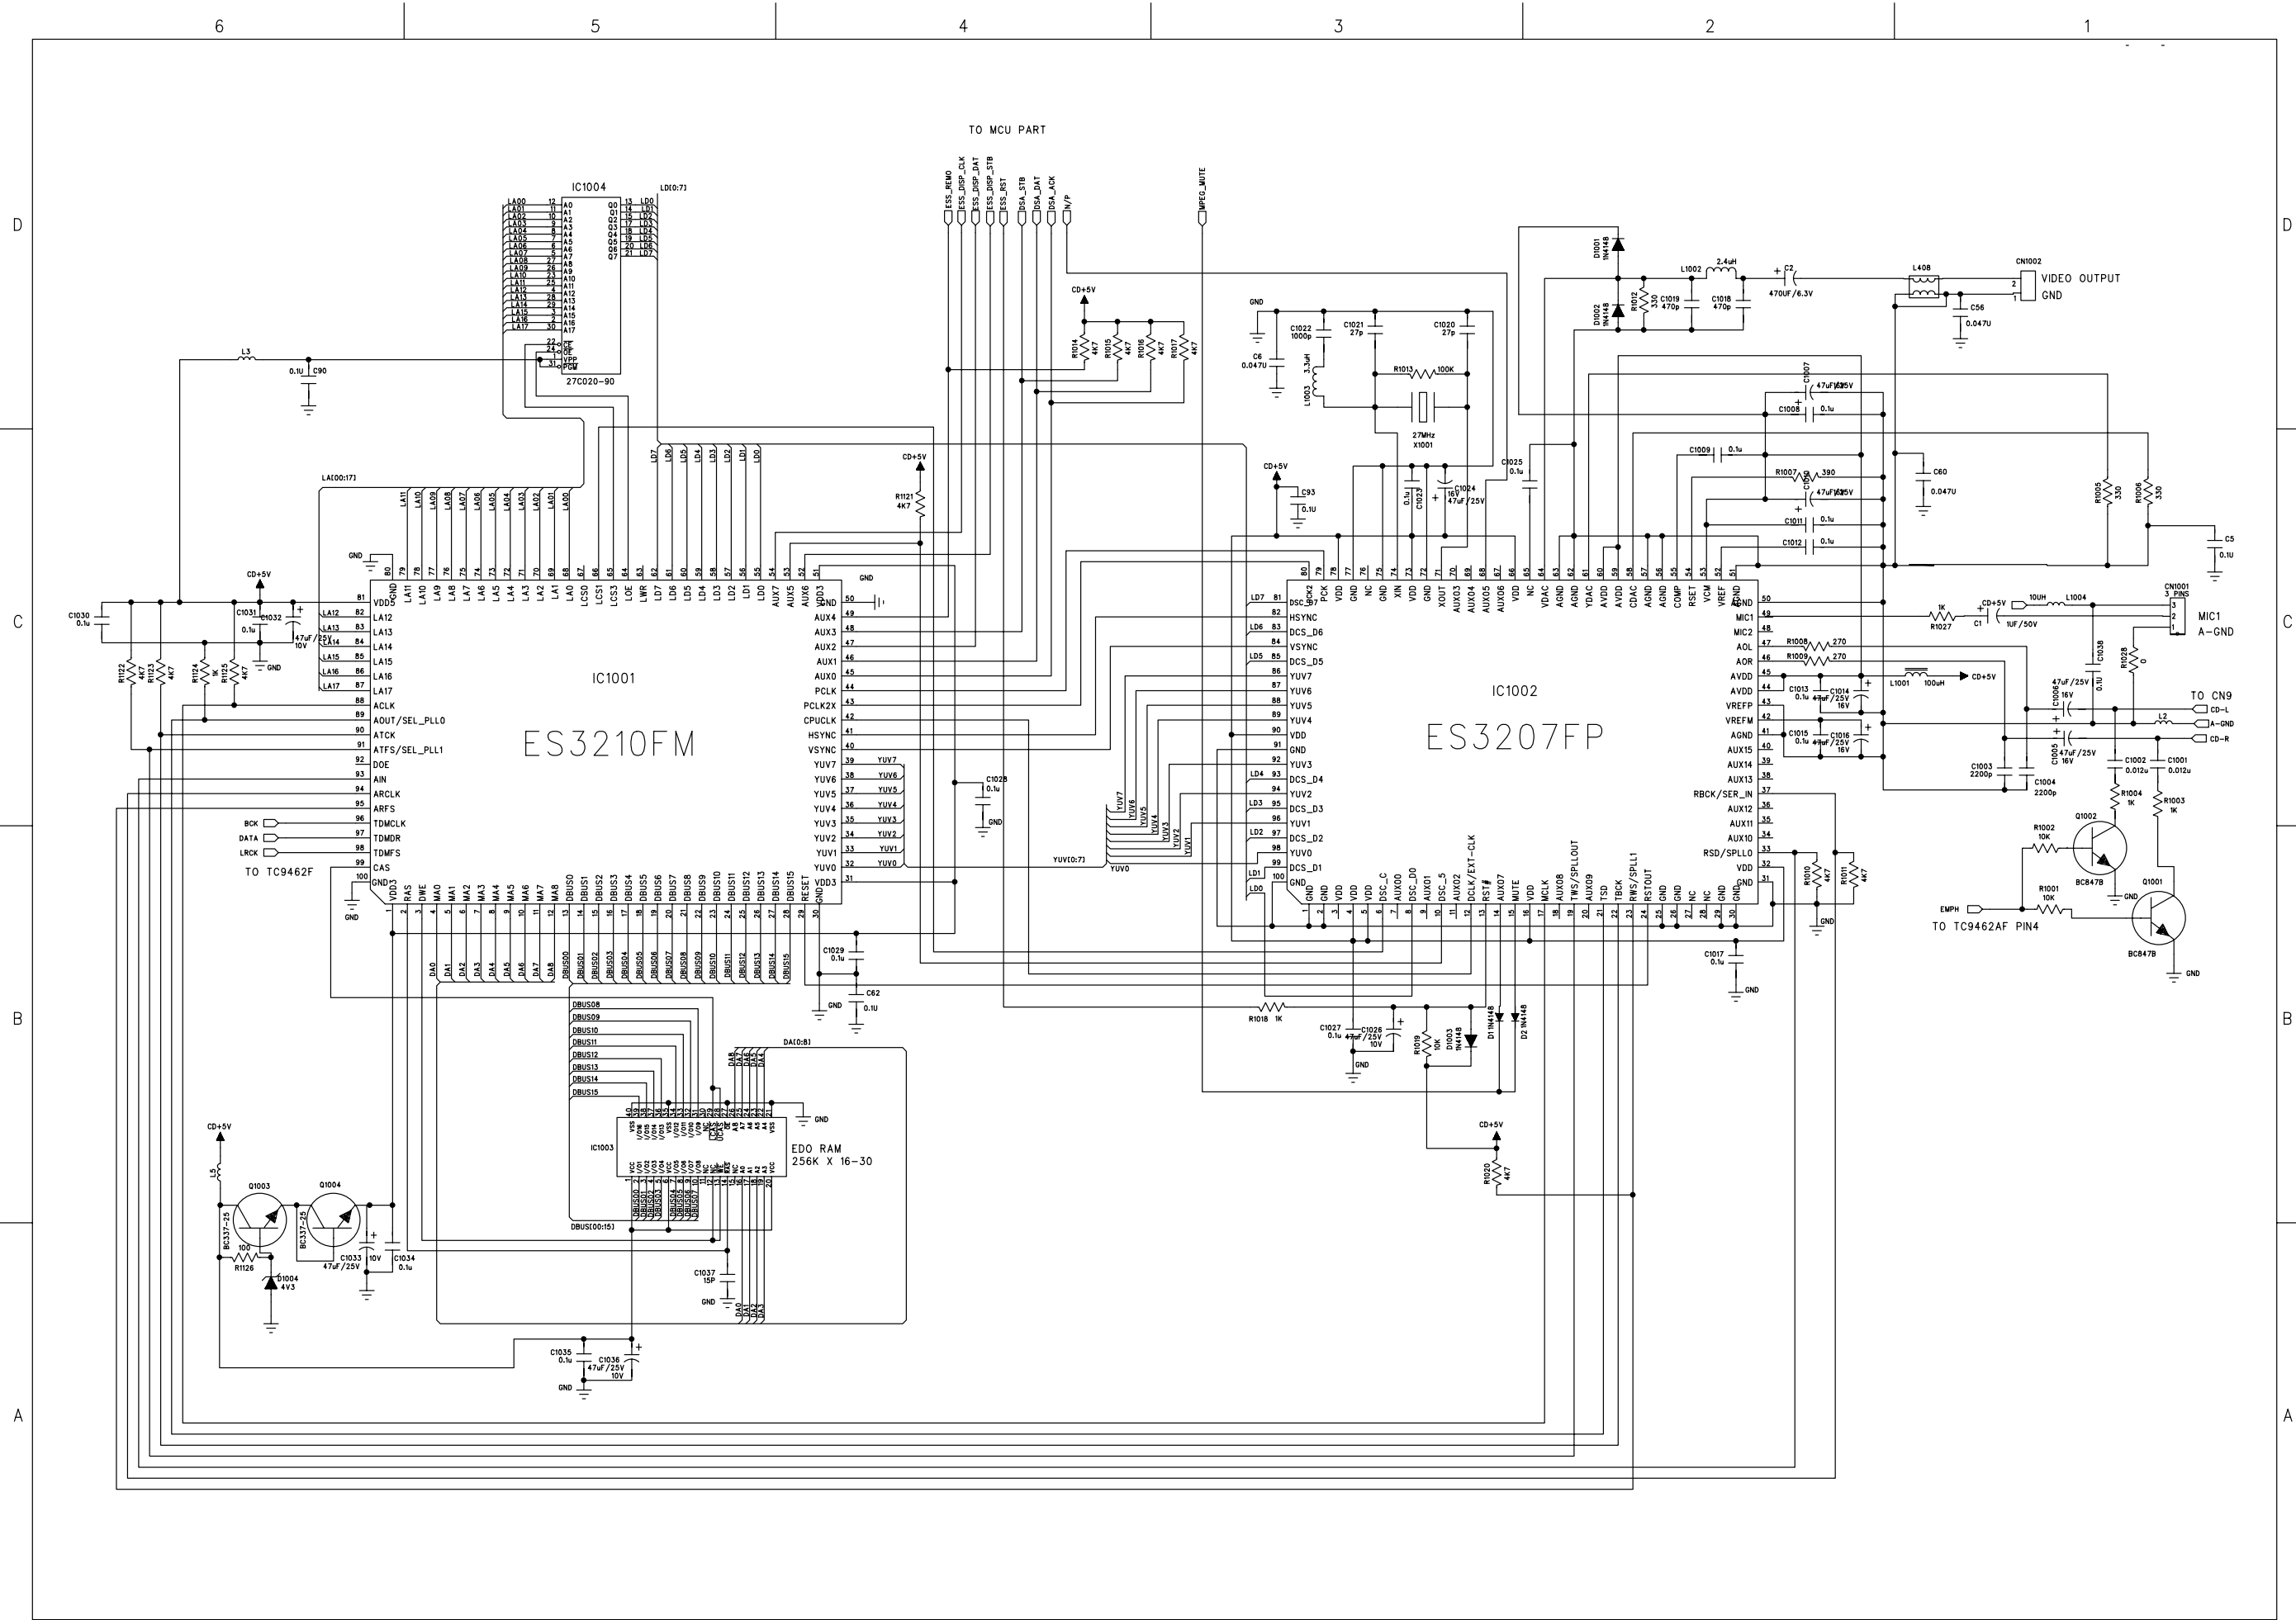

LAYOUT DIAGRAM - MCU & VCD BOARD COMPONENT SIDE

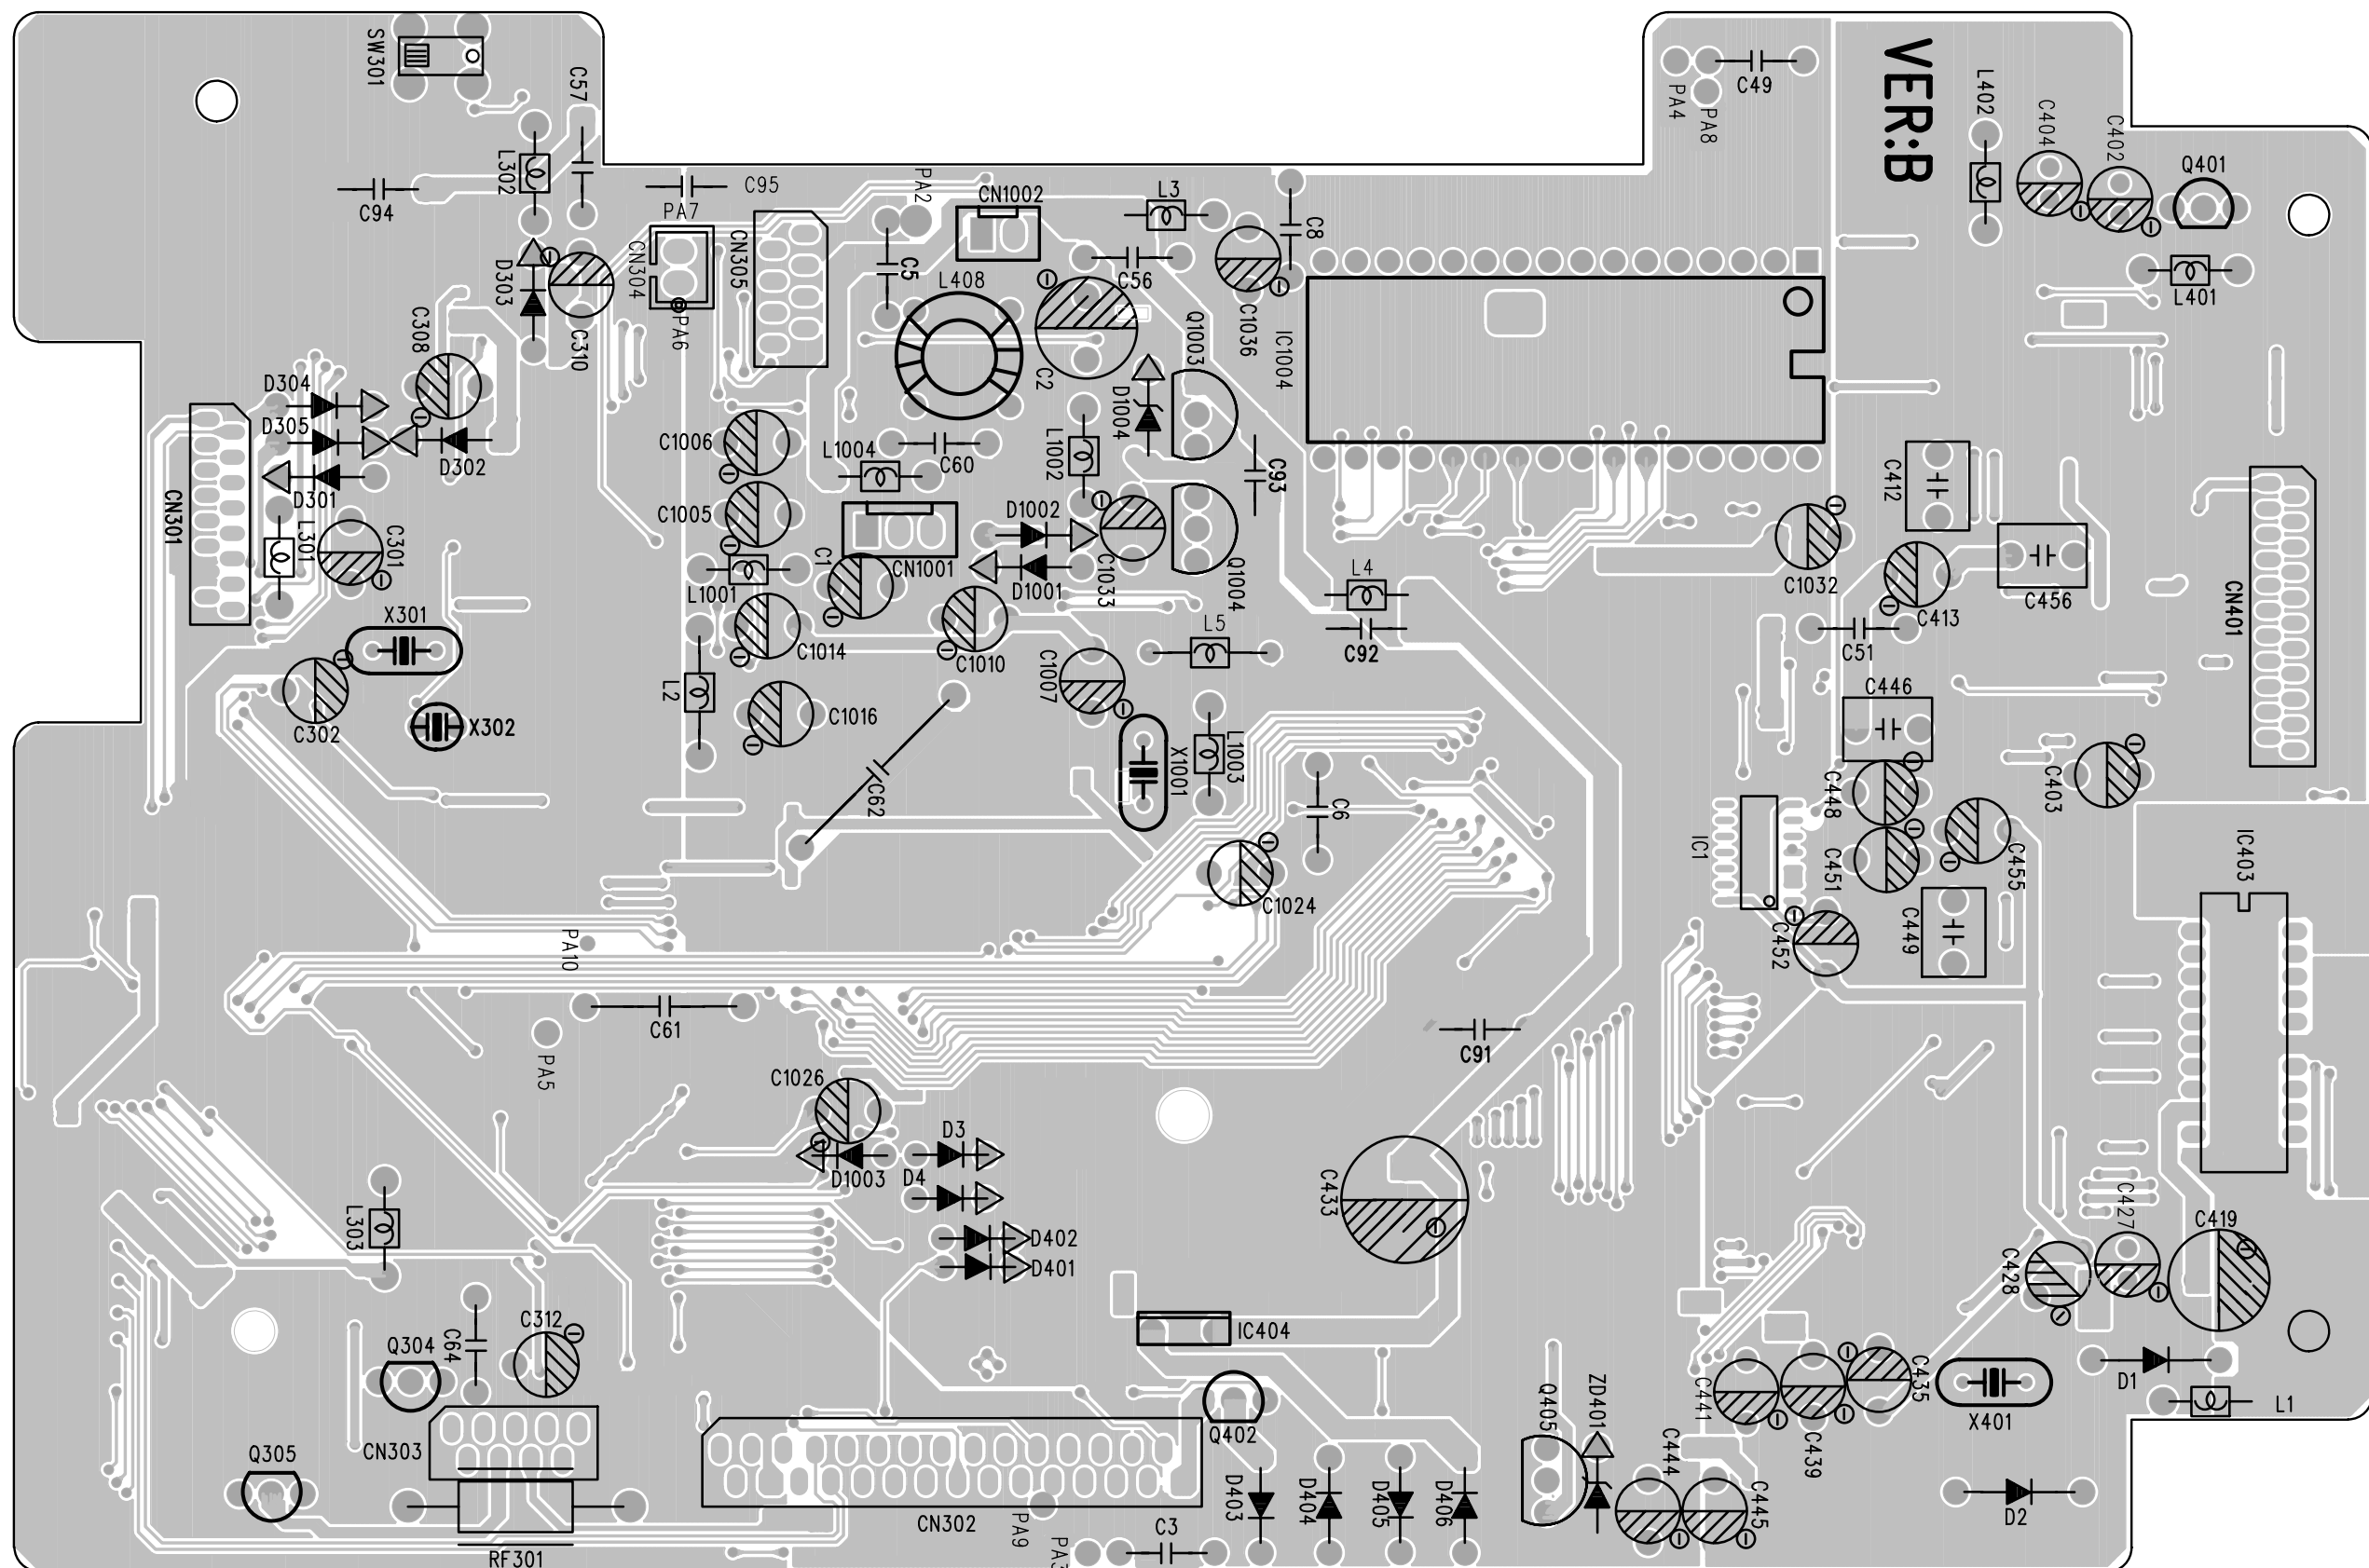

LAYOUT DIAGRAM - MCU & VCD BOARD SMD SIDE